

Shaft Alignment Report

SKF

Report Name: SJOG CDWP 02

Machine ID: CDWP-02

Operator: Adam Hurlbatt

Date: 05-12-2025

Previous Alignment: 05-12-2025

Instrument: TKSA-41

Serial No. MU-M: TKSA41-M-2523-0087

Serial No. MU-S: TKSA41-S-2523-0079

Measuring Unit Temperature: 28.19 °C


Comments: New Install. Master flow



Soft Foot


Soft Foot checked: Yes

As Found

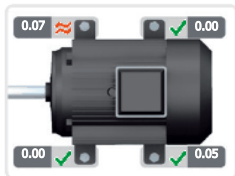

Soft Foot checked: Yes

As Corrected

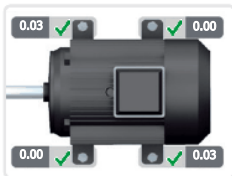


Soft Foot Tolerance: 0.05mm

Dimensions


Tolerances

mm/100mm	mm
0.08	0.1

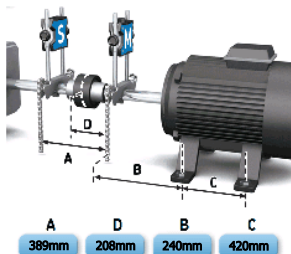

Alignment Results

Horizontal: Top View



As Found

	-0.01 mm/100mm	✓
	-0.96 mm	✗

As Corrected

	-0.01 mm/100mm	✓
	0.06 mm	✓

Vertical: Side View



As Found

	0.23 mm/100mm	✗
	-0.18 mm	⚠

As Corrected

	-0.02 mm/100mm	✓
	-0.01 mm	✓

Signature:

Date:

Backlash within tolerance: Yes

